


Sto reStore Cracks in reveals - hairline

Detail No.: 74.03a

Date: December 2010

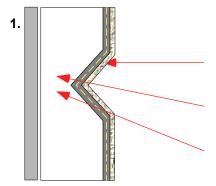


Base coat and finish are uniform thickness

Insulation continuous behind reveal


Minimum 0.75" (20 mm) of insulation behind reveal

1. Correctly installed EIFS reveal.

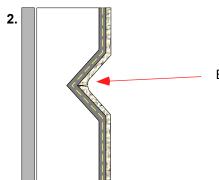

Excess finish left in reveal

2. Too much finish left in the reveal will lead to shrink cracking. This is a cosmetic condition and may be repaired by dabbing finish paste into the crack. Refer to StoTherm® EIFS Reference Guide: Repair and Maintenance, Repair of Surface Cracks in EIFS 2.01.

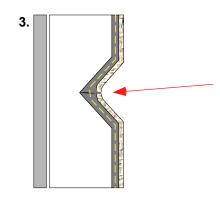

Excess base coat installed in reveal

3. Too much base coat left in the reveal will lead to shrink cracking in the base coat which may carry through the finish. This is a cosmetic condition and may be repaired by dabbing in base coat, allowing to dry and then dabbing finish paste into the crack. Refer to StoTherm® EIFS Reference Guide: Repair and Maintenance, Repair of Surface Cracks in EIFS 2.01

Sto Corp.

3800 Camp Creek Parkway Building 1400, Suite 120 Atlanta, GA 30331 Phone 404-346-3666 Toll Free 888-786-3437

Fax 404-346-3119 www.stocorp.com

Attention

Sto products are intended for use by qualified professional contractors, not consumers, as a component of a larger construction assembly as specified by a qualified design professional, general contractor or builder. They should be installed in accordance with those specifications and Sto's instructions. Sto Corp. disclaims all, and assumes no, liability for on-site inspections, for its products applied improperly, or by unqualified persons or entities, or as part of an improperly designed or constructed building, for the nonperformance of adjacent building components or assemblies, or for other construction activities beyond Sto's control. Improper use of Sto products or use a part of an improperly designed or constructed larger assembly or building may result in serious damage to Sto products, and to the structure of the building or its components. STO CORP DISCLAIMS ALL WARRANTIES EXPRESS OR IMPLIED EXCEPT FOR EXPLICIT LIMITED WRITTEN WARRANTIES ISSUED TO AND ACCEPTED BY BUILDING OWNERS IN ACCORDANCE WITH STO'S WARRANTY PROGRAMS WHICH ARE SUBJECT TO CHANGE FROM TIME TO TIME. For the fullest, most current information on proper application, clean-up, mixing

and other specifications and warranties, cautions and disclaimers, please refer to the Sto Corp. website,

www.stocorp.com.