
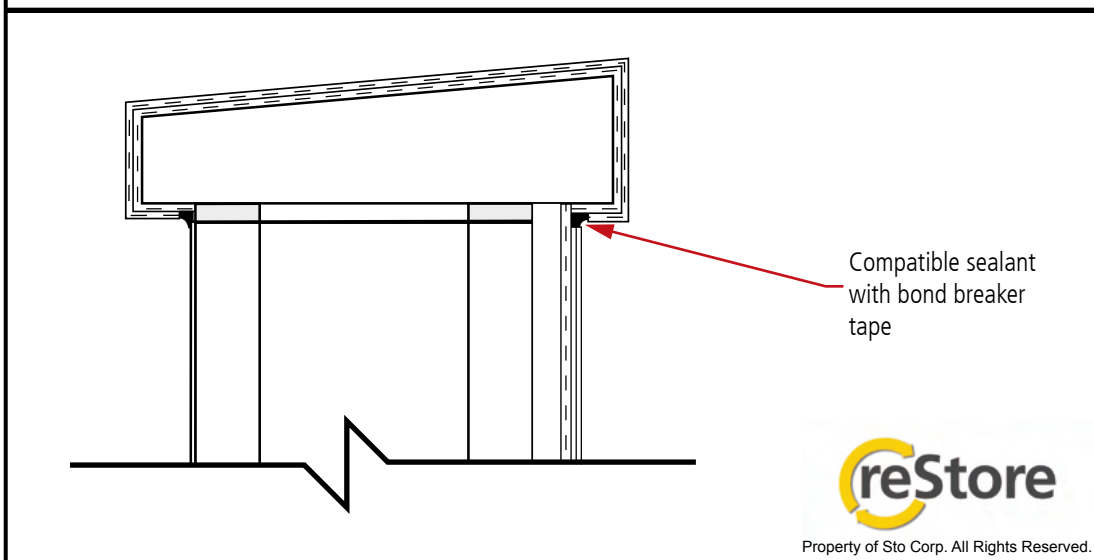


# reStore Stucco Parapet Cap Repair

Detail No.: 72.20.80  
Date: November 2015

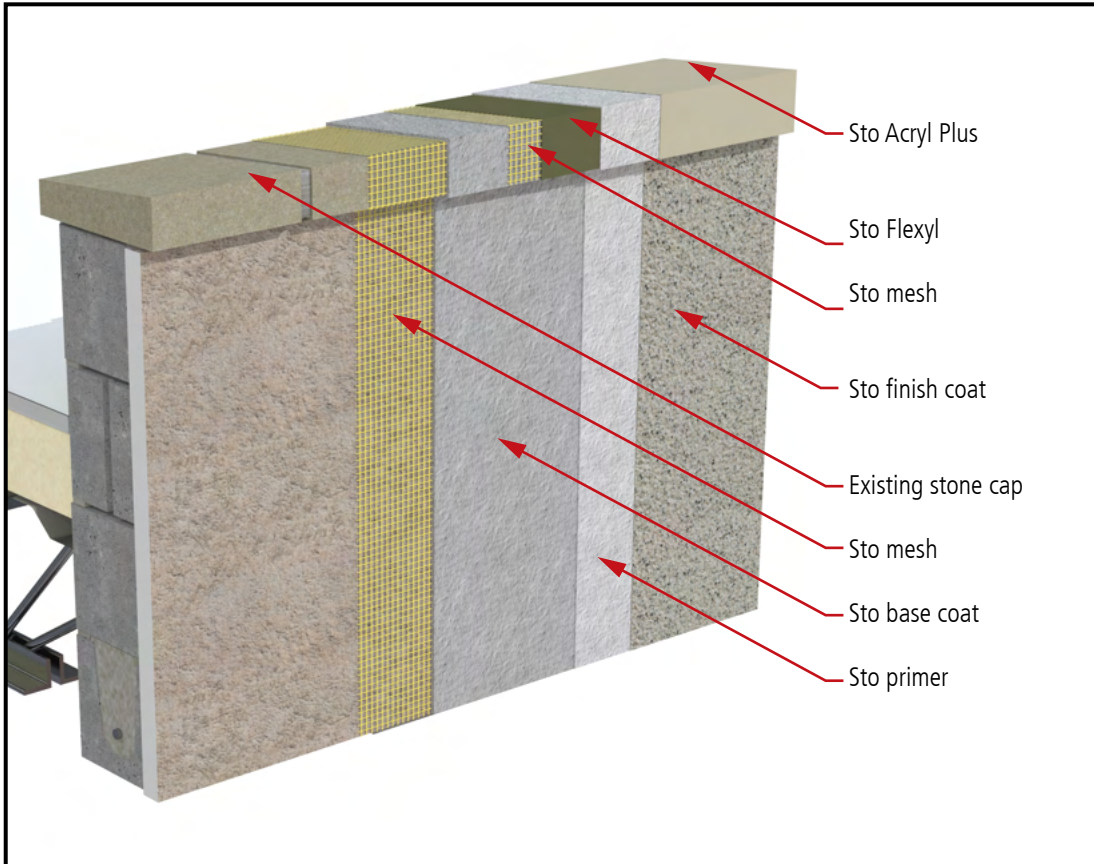

Notes:

1. Sto recommends use of metal coping to correct leaking parapet caps. However, the application shown provides an option where metal coping is not specified by the designer.
2. Clean existing stone cap to remove all dust, dirt, mold, mildew, oils, salts, or other bond inhibiting materials.
3. If necessary repair damaged cap stones or repair anchorage of stones to the wall.
4. Apply Sto Dispersion Adhesive wash to glazed tile or terra cotta cap. Dilute Sto Dispersion Adhesive 10 percent with clean water and roll onto surface. Apply next coating layer as soon as the Sto Dispersion wash has dried.
5. Apply Sto base coat and Sto Mesh to cap surface. Use Sto BTS Xtra base coat where joints between cap units require more than 1/8 in. (3.2 mm) to bring surface to an even plane.
6. Apply Sto Flexyl waterproof base coat with Sto Mesh to parapet cap. Return Sto Flexyl and Sto Mesh minimum 2 inches onto wall on both sides of parapet, OR terminate Sto Flexyl and Sto Mesh at interface with wall and seal with compatible sealant as shown in section detail.
7. Apply Sto Primer (optional)
8. Apply 2 coats of StoCoat Acryl Plus to the dry Sto Flexyl.
9. All mixing, installation, and curing of Sto products must comply with written specifications and literature available at [www.stocorp.com](http://www.stocorp.com).

**IMPORTANT:** Components not identified as Sto are furnished by other manufacturers and are not necessarily installed by trades who install the Sto products. Refer to project specific contract documents.

**ATTENTION**

Sto products are intended for use by qualified professional contractors, not consumers, as a component of a larger construction assembly as specified by a qualified design professional, general contractor or builder. They should be installed in accordance with those specifications and Sto's instructions. Sto Corp. disclaims all, and assumes no, liability for on-site inspections, for its products applied improperly, or by unqualified persons or entities, or as part of an improperly designed or constructed building, for the nonperformance of adjacent building components or assemblies, or for other construction activities beyond Sto's control. Improper use of Sto products or use as part of an improperly designed or constructed larger assembly or building may result in serious damage to Sto products, and to the structure of the building or its components.

STO CORP. DISCLAIMS ALL WARRANTIES EXPRESSED OR IMPLIED EXCEPT FOR EXPLICIT LIMITED WRITTEN WARRANTIES ISSUED TO AND ACCEPTED BY BUILDING OWNERS IN ACCORDANCE WITH STO'S WARRANTY PROGRAMS WHICH ARE SUBJECT TO CHANGE FROM TIME TO TIME. For the fullest, most current information on proper application, clean-up, mixing and other specifications and warranties, cautions and disclaimers, please refer to the Sto Corp. website, [www.stocorp.com](http://www.stocorp.com).